



**BMW 5 TOURING: 1KXK012**

Vinnumber:	<b>WBA5L11090D786145</b>	Versionname:	<b>2.0 518D (110KW) TOURING</b>
First Registrationdate:	<b>23/07/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>144412</b>	Power Kw:	<b>110</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance	<b>PLUS 5000 KM</b>	Parking lot:	<b>LKW2</b>
Maintenance	<b>OK</b>		
Battery functioning	<b>Yes</b>		
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Aluminium</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

**Options**

Radio CD		Seats electric F L	
GPS storage	<b>HD</b>	Seats electric F R	
GPS storage		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>225/55/17/97 H LightMetal</b>				
Winter tyres:	Fr.L.	<b>Goodyear: 6 mm</b>	Fr.R.	<b>Goodyear: 6 mm</b>
	Re.L.	<b>Michelin: 7 mm</b>	Re.R.	<b>Michelin: 7 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Total cost ex VAT			<b>1993,00</b>
Maintenance, Maintenance, P - Check			<b>0,00</b>



Rocker panel inner F L, Deformed / Strained, E - Replace 25,00



Rearview mirror basis R, Scratch(es), Acceptable 0,00

*No pictures to display*


Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 302,16



Side window trim R L, Scratch(es), Smart repair 110,64



Rear window, Scratch(es), E - Replace 0,00

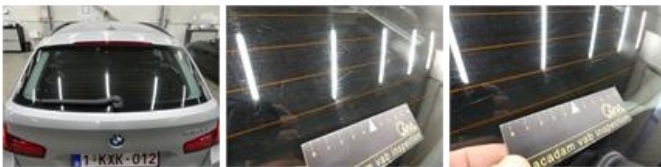

Rearview mirror housing R, Scratch(es), Acceptable 0,00

*No pictures to display*

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Dent(s), PDR - Paintless dent repair 82,80



Alloy rim F L, Scratch(es), Acceptable 0,00

*No pictures to display*

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)

420,60



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Dent(s) and scratch(es), Le - Replace and paint

766,80

