



SKODA OCTAVIA COMBI: 1PUZ107

Vinnumber:	TMBJG9NE3H0056857	Versionname:	1.6 CRTDI 81KW GREENTEC STYLE
First Registrationdate:	26/09/2016	Fiscalpower:	
Expertise Mileage:	95270	Power Kw:	81
Bodytype:		Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3232
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Seats F heated	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/45/17/92 H LightMetal				
Summer tyres:	Fr.L.	Dunlop: 4 mm	Fr.R.	Dunlop: 4 mm
	Re.L.	Dunlop: 5 mm	Re.R.	Dunlop: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1788,35
-------------------	----------------

Bumper grille F R, Dent(s), E - Replace	32,40
---	--------------



Wing R L, Dent(s), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), LI - Repair and paint (complete) 318,35



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Stone chip(s), Windscreen repair 58,80



Bumper F, Crack, Le - Replace and paint 735,00



Door F L, Dent(s), Acceptable 0,00

No pictures to display


Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), E - Replace 370,00

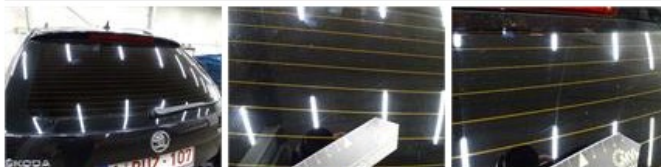

Protection plate M, Deformed / Strained, E - Replace 62,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display