



PEUGEOT 308 SW: 1KNB703

Vinnumber:	VF3LCBHXF5124535	Versionname:	1.6 BLUEHDI 85KW S/S ACTIVE
First Registrationdate:	1/06/2015	Fiscalpower:	
Expertise Mileage:	118453	Power Kw:	85
Bodytype:		Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2328
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/92 H LightMetal			
Summer tyres:	Fr.L.	Fr.R.	Michelin: 4 mm
	Re.L.	Re.R.	Michelin: 5 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 3038,88

Wing F L, Scratch(es), It - Spot repair 115,56



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80

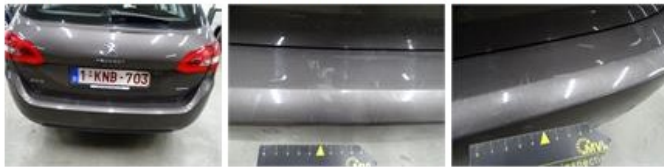

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F, Broken, Smart repair 110,64



Rear window, Scratch(es), E - Replace 370,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Wing R R, Dent(s), LI - Repair and paint (complete) 332,20



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 332,20

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Sill outer L, Dent(s), LI - Repair and paint (complete)

310,50



Wing F R, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display