



AUDI Q5: 1KSE047

Vinnumber:	WAUZZZ8R2GA008381	Versionname:	2.0 TDI 110KW
First Registrationdate:	22/06/2015	Fiscalpower:	
Expertise Mileage:	156399	Power Kw:	110
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3724
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage		Luggage cover
GPS storage	DVD	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/65/17/104 H LightMetal				
Winter tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Fulda: 4 mm	Re.R.	Fulda: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	3079,08
Bumper R, Broken, Le - Replace and paint	766,80



Roof pillar R, Dent(s), Acceptable 0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02



Bumper F L, Scratch(es), It - Spot repair 115,56



Tailgate, Scratch(es), LI - Repair and paint (complete) 362,02




Roof, Dent(s), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), LI - Repair and paint (complete) 382,02



Roof, Dent(s), PDR - Paintless dent repair 102,60

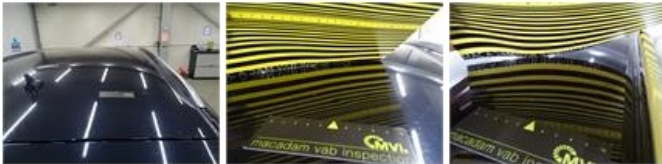

Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Reflector, Broken, E - Replace 121,20



Wing F L, Dent(s), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), LI - Repair and paint (complete) 369,84



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00

