


RENAULT CLIO: 1LUV873

Vinnumber:	VF15R0J0A53968411	Versionname:	1.5 ENERGY DCI 90E EXPRESSION
First Registrationdate:	11/12/2015	Fiscalpower:	
Expertise Mileage:	102415	Power Kw:	66
Bodytype:		Body color:	Red
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4323
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	185/65/15/92 V Steel			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2320,87
Bumper F, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Dent(s), PDR - Paintless dent repair	82,80

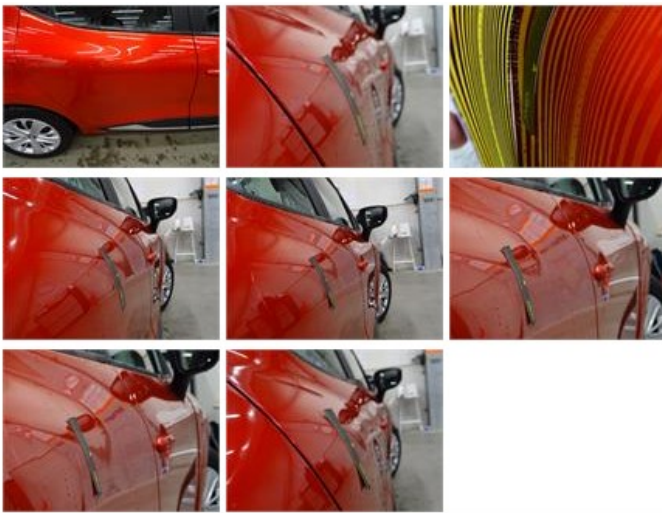

Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Door F R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Crack, Le - Replace and paint 448,01



Wing R L, Scratch(es), LI - Repair and paint (complete) 246,56



Roof, Chemical pollution, LI - Repair and paint (complete) 385,20



Instrument panel cover, Worn, Acceptable 0,00



Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), E - Replace 24,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 169,44



Brand badge R, Missing, E - Replace 20,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,68





Wheel cover F L, Scratch(es), E - Replace

24,00




Wing R R, Dent(s), LI - Repair and paint (complete)

294,56



Bonnet, Deformed / Strained, LI - Repair and paint (complete)

232,06

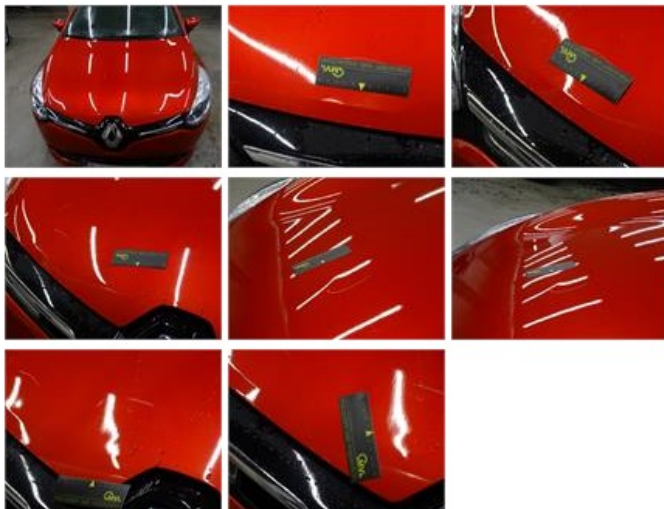

Wheel cover R R, Scratch(es), E - Replace

24,00



Door F L, Scratch(es), Acceptable

0,00

No pictures to display