



**TOYOTA Auris: 1GNU626**

Vinnnumber:	<b>SB1ZN3JE80E022369</b>	Versionname:	<b>AURIS TOUR.SP. Comfort</b>
First Registrationdate:	<b>20/03/2014</b>	Fiscalpower:	<b>Alu 90PK</b>
Expertise Mileage:	<b>172246</b>	Power Kw:	<b>66</b>
Bodytype:	<b>Break</b>	Body color:	<b>Light Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2831</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	
Windows electric R	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	<b>Headlighting Halogen</b>
Type of GPS:	<b>GPS big screen color</b>
Type of Lining:	<b>Lining fabrics</b>
Type of climate control:	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		

**Degree of wear**

	<b>205/55/16/91 V LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Michelin: 4 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
		Jack	<b>Yes</b>

Total cost ex VAT	4714,26
-------------------	---------

Interior, Dirty, Cleaning	100,00
---------------------------	--------



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Ignition key, Missing, E - Replace 150,00

No pictures to display

Trunk lid covering R, Damaged, Smart repair 110,64





Door F L, Bump(s) and scratch(es), Le - Replace and paint 0,00



Luggage space cover, Missing, E - Replace 240,00



Door R L, Bump(s) and scratch(es), Le - Replace and paint 946,92

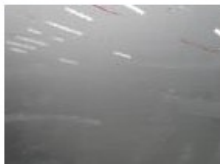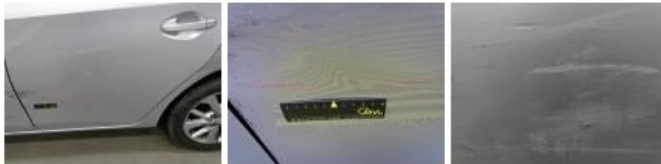

Front bumper, Bump(s) and scratch(es), Le - Replace and paint 735,00



Wing R L, Bump(s) and scratch(es), Le - Replace and paint 0,00



Wing F R, Bump(s), LI - Repair and paint (complete) 220,18



Rearview mirror housing R, Damaged, Le - Replace and paint 134,00



Wing F L, Bump(s) and scratch(es), Le - Replace and paint 530,02



Bumper R, Bump(s) and scratch(es), Le - Replace and paint 651,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Headlight L, Damaged, E - Replace 396,00



Sill outer L, Bump(s) and scratch(es), LI - Repair and paint (complete) 310,50

