



MERCEDES C: 1GGV229			
Vinnnumber:	WDD2042001G155650	Versionname:	C BRE 180 CDI BlueEFF. S&S 120PK
First Registrationdate:	4/02/2014	Fiscalpower:	
Expertise Mileage:	160278	Power Kw:	88
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3225
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Seats electric F L
Windows electric F	Seats electric F R
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Radio multimedia	Rear parking sensors
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	NOT OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear				
	205/55/16/91 V LightMetal			
Summer tyres:	Fr.L.	Bridgestone: 7 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Pirelli: 3 mm

Assistance equipment			
Spare tyre compact	Yes	Jack	Yes

Total cost ex VAT	4185,00
Door R L, Scratch(es), 67 - Polish	55,19



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	356,20
---	---------------



Roof, Scratch(es), LI - Repair and paint (complete)	481,50
---	---------------



Interior, Smell, Ozone treatment 152,58

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Sill outer R, Bump(s) and scratch(es), Le - Replace and paint 712,00



Bonnet, Stone chip(s), LI - Repair and paint (complete) 290,08



Fire extinguisher, Missing, E - Replace 12,00



Floor covering F L, Burned, Smart repair 64,32








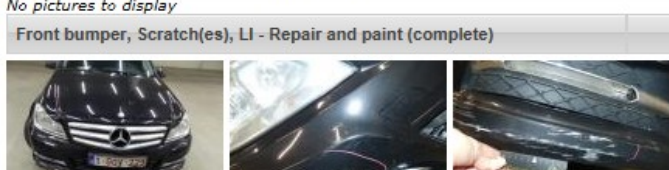


Seat cover F R, Stain, Cleaning 25,00



Seat cover F L, Burned, E - Replace 360,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

	Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	316,18
	Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
	Foglight R, Broken, E - Replace	138,00
	Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
	Door F L, Bump(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
	Bumper moulding F R, Broken, Le - Replace and paint	100,00
	Door R R, Scratch(es), LI - Repair and paint (complete)	318,35
