



FORD TOURNEO: 1AFD565

Vinnumber:	WF0JXXTPJAB22779	Versionname:	
First Registrationdate:	21/12/2010	Fiscalpower:	
Expertise Mileage:	196066	Power Kw:	66
Bodytype:	Break	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3823
Number of doors:	6		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD	Central consol F
Windows electric F	
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	195/65/15/95 T Steel			
Summer tyres:	Fr.L.	Vredestein: 6 mm	Fr.R.	Vredestein: 6 mm
	Re.L.	Vredestein: 4 mm	Re.R.	Vredestein: 4 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	2802,56
Wheel cover R R, Missing, E - Replace	22,50



Wing F R, Scratch(es), It - Spot repair	115,56
---	--------



Floor covering F L, Hole, E - Replace	237,00
---------------------------------------	--------



Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 165,13



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 231,15



Interior, Dirty, Cleaning 100,00



Wheel cover F R, Missing, E - Replace 22,50



Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete) 158,85




Ignition key, Missing, E - Replace 150,00

No pictures to display

Roof pillar R, Bump(s), PDR - Knock out without painting 82,80



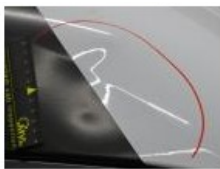

Roof pillar L, Bump(s), LI - Repair and paint (complete)

165,14



Bumper grille, Damaged, E - Replace

74,00



Door trim R R, Damaged, Smart repair

110,64



Wheel cover F L, Scratch(es), E - Replace

22,50



Wheel cover R L, Missing, E - Replace

22,50



Door F R, Damaged, Le - Replace and paint

847,88



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete)

158,85



Trunk door R L, Bump(s) and scratch(es), It - Spot repair

115,56

