



VOLKSWAGEN Touran: 1GGO015

Vinnnumber:	WVGZZZ1TZEW064174	Versionname:	TOURAN Trendline 90PK
First Registrationdate:	3/02/2014	Fiscalpower:	
Expertise Mileage:	115232	Power Kw:	66
Bodytype:	MPV	Body color:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3116
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD
Windows electric F	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	195/65/15/91 H Steel			
Winter tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Uniroyal: 7 mm	Re.R.	Uniroyal: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 2934,49

Door panel F R, Damaged, E - Replace 138,00



Bonnet, Scratch(es), Acceptable 0,00


No pictures to display

Wheel cover F L, Scratch(es), E - Replace 30,00


			<p>Door F R, Scratch(es), LI - Repair and paint (complete) 318,35</p>
			<p>Roof, Chemical pollution, LI - Repair and paint (complete) 481,50</p>
			<p>Seat cover F R, Damaged, Acceptable 0,00</p>
			<p>Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20</p>
			<p>Seat cover R R, Stain, Cleaning 25,00</p>
			<p>Glove compartment lid, Scratch(es), Acceptable 0,00</p>
			<p>Front bumper, Scratch(es), It - Spot repair 115,56</p>
			<p>Wheel cover R L, Damaged, E - Replace 487,20</p>



Bumper R, Bump(s) and scratch(es), Le - Replace and paint 651,00

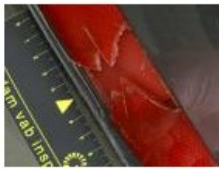

Tailgate, Bump(s), LI - Repair and paint (complete) 349,68

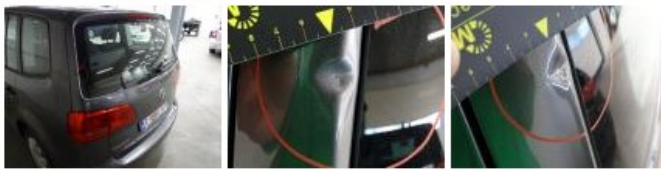

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace 30,00



Windscreen, Stone chip(s), E - Replace 0,00

