



VOLKSWAGEN Sharan: 1FCL747

Vinnumber:	WVWZZZ7NZDV036129	Versionname:	SHARAN Comfortline BMT
First Registrationdate:	24/05/2013	Fiscalpower:	115PK
Expertise Mileage:	172537	Power Kw:	85
Bodytype:	MPV	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3605
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Sun Roof electric	
GPS storage	HD	Panoramic roof	
GPS storage		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional			
Seats F heated			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		










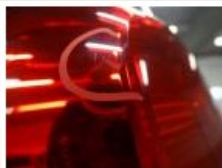




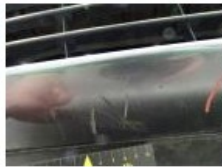







Degree of wear

	215/60/16/95 H LightMetal			
Winter tyres:	Fr.L.	Dunlop: 4 mm	Fr.R.	Dunlop: 4 mm
	Re.L.	Dunlop: 7,5 mm	Re.R.	Dunlop: 7,5 mm

Assistance equipment

Total cost ex VAT	2429,13
Door R L, Bump(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Chemical pollution, LI - Repair and paint (complete)	348,09



		Roof, Chemical pollution, LI - Repair and paint (complete)	577,80	
		Trunk lid covering R, Scratch(es), Acceptable	0,00	
<i>No pictures to display</i>				
Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)			430,02	
			Rearlight L, Scratch(es), E - Replace	132,00
				
				
Ignition key, Not functioning (well), E - Replace			0,00	
<i>No pictures to display</i>				
Tyre repair kit, Missing, E - Replace			252,64	
				
Door F L, Scratch(es), Acceptable			0,00	
<i>No pictures to display</i>				
Front bumper, Scratch(es), It - Spot repair			115,56	
				
				
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)			95,00	
				
Windscreen, Stone chip(s), Acceptable			0,00	
<i>No pictures to display</i>				
Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete)			478,02	

