



PEUGEOT Boxer 330: 1EHS696 NO EXPERTISE

Vinnnumber:	VF3YASMFA12330559	Versionname:	BOXER 330 B/F SWB HR L1H2 FAP 110PK
First Registrationdate:	6/12/2012	Fiscalpower:	
Expertise Mileage:	110291	Power Kw:	81
Bodytype:	Transporter	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV26
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Steering wheel multifunctional	Rear parking sensors
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/70/15/109 R Steel			
Winter tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 9 mm
	Re.L.	Michelin: 5 mm	Re.R.	Bridgestone: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT 1032,33

Rearlight L, Scratch(es), 67 - Polish 55,19



Spare Tyre, Flat, 1 - Repair 35,00



Sliding door panel R, Broken, E - Replace 50,00




Trunk door panel R, Broken, E - Replace 40,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 231,15



Trunk door R R, Scratch(es), Acceptable 0,00

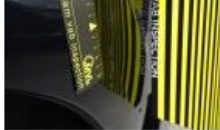

No pictures to display

Rearview mirror housing R, Damaged, E - Replace 124,00



Wing trim R R, Missing, E - Replace 69,00



Trunk door panel L, Broken, E - Replace 40,00



Windscreen, Stone chip(s), Windscreen repair 58,80



Ignition key, Missing, E - Replace 150,00

No pictures to display

Rearlight R , Scratch(es), 67 - Polish 55,19



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), E - Replace 124,00

