


TOYOTA Grand Prius Plus: 1FAP949

Vinnnumber:	JTDZ53EU903064129	Versionname:	GRAND PRIUS+ Hybrid Active 98PK Aut.
First Registrationdate:	8/05/2013	Fiscalpower:	
Expertise Mileage:	70705	Power Kw:	73
Bodytype:	MPV	Body color	Light Grey
Gearbox:	Automatic	Paint type	Metalic
Transmission:		Rims summer	Steel
Fueltype:	Hybrid Petrol	Oil level	OK
Battery functioning	Yes	Parking lot	2432
Number of doors	5		
Number of seats	7		
Number head rests	7		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		

Options

Radio CD	Central consol F
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 V Steel			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

Assistance equipment

Total cost ex VAT	3152,86
Rocker panel inner R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	115,56



Rearview mirror housing R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Scratch(es), LI - Repair and paint (complete)	318,35



Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Damaged, E - Replace 235,20



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 220,18



Interior, Dirty, Cleaning 0,00



Wheel cover F L, Scratch(es), E - Replace 30,00




Wing F L, Bump(s), LI - Repair and paint (complete) 220,18



Rocker panel inner R R, Bump(s), LI - Repair and paint (complete) 115,56



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35

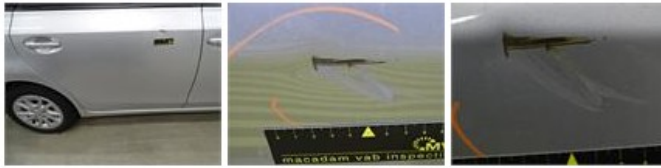

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Rearlight L, Scratch(es), Acceptable 0,00

No pictures to display

Ignition key, Missing, E - Replace 150,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Tailgate, Bump(s), LI - Repair and paint (complete) 301,68



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20



Headlight R, Scratch(es), E - Replace 396,00

