


TOYOTA Auris: 1GGL506

Vinnnumber:	SB1MS3JE50E065134	Versionname:	AURIS BER HSD
First Registrationdate:	3/02/2014		Hybr.Premium CVT 99PK
Expertise Mileage:	52939	Fiscalpower:	Aut.
Bodytype:	Hatchback	Power Kw:	73
Gearbox:	Automatic	Body color	Brown
Transmission:	Front	Paint type	Metalic
Fueltype:	Hybrid Petrol	Rims summer	Aluminium
Battery functioning	Yes	Oil level	OK
Number of doors	5	Parking lot	3703
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Panoramic roof
GPS storage		Central consol F
GPS storage	HD	Luggage cover
Windows electric F		Front parking sensors
Windows electric R		Rear parking sensors
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/45/17/91 W LightMetal			
Summer tyres:	Fr.L.	Dunlop: 6 mm	Fr.R.	Dunlop: 6 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	588,80
-------------------	---------------

Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------





Bonnet, Bump(s), PDR - Knock out without painting 63,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Front bumper, Bad repair, Acceptable 0,00




Roof, Bump(s), PDR - Knock out without painting 63,00




Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Roof pillar L, Chemical polution, Acceptable	0,00
<i>No pictures to display</i>	
Mirror side blinker R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00

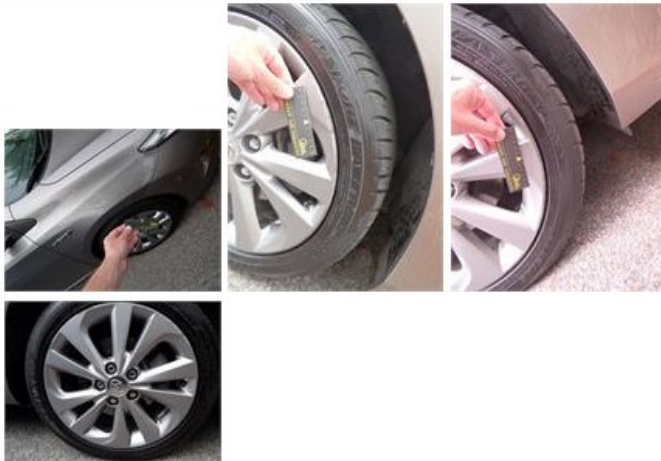

Bonnet, Bump(s), PDR - Knock out without painting	82,80
---	-------

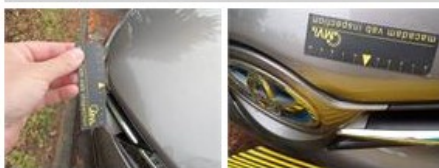

Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Spoiler R, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	