



SKODA Rapid: 1HHG873			
Vinnumber:	TMBEL6NH2F4506655	Versionname:	RAPID SB Elegance 105
First Registrationdate:	23/07/2014	Fiscalpower:	
Expertise Mileage:	153039	Power Kw:	77
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2823
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options			
Radio CD		Panoramic roof	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	NOT OK

Degree of wear				
	215/45/16/90 V LightMetal			
Summer tyres:	Fr.L.	Kleber: 7 mm	Fr.R.	Kleber: 7 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment			
Spare wheel	Yes	Jack	Yes

Total cost ex VAT	3809,78
Door F L, Scratch(es), LI - Repair and paint (complete)	318,35



Rearview mirror housing L, Scratch(es), Smart repair	110,64
--	---------------



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35



Wing F R, Bump(s) and scratch(es), Le - Replace and paint 530,02



Wing F L, Bump(s) and scratch(es), Le - Replace and paint 530,02



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00





Armrest F Mid, Damaged, E - Replace 104,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20




Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Interior, Dirty, Cleaning 50,00



Windscreen, Damaged, E - Replace 0,00

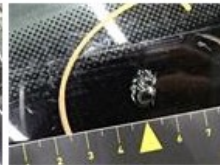

Bumper grille, Damaged, E - Replace 32,40



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00





Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Headlight L, Damaged, E - Replace 396,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Bump(s) and scratch(es), Le - Replace and paint 0,00

