


VOLKSWAGEN TIGUAN: 1EQ0424

Vinnnumber:	WVGZZZ5NZDW073749	Versionname:	TIGUAN Trend&Fun BM Tech.110PK
First Registrationdate:	25/02/2013	Fiscalpower:	
Expertise Mileage:	143859	Power Kw:	81
Bodytype:	SUV	Body color	Brown
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3522
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options

Radio CD	Sun Roof electric
Windows electric F	Panoramic roof
Windows electric R	Central consol F
Steering wheel multifunctional	Luggage cover
Type of headlighting Headlighting Halogen	Front parking sensors
Type of GPS No GPS	Rear parking sensors
Type of Lining Lining fabrics	Type of Tow bar Tow bar fixed
Type of climate control Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/65/16/98 H LightMetal			
Summer tyres:	Fr.L.	Hankook: 4 mm	Fr.R.	Hankook: 4 mm
	Re.L.	Hankook: 4 mm	Re.R.	Hankook: 4 mm

Assistance equipment

Emergency spare wheel	Yes
-----------------------	------------

Total cost ex VAT	1963,15
-------------------	---------

Front bumper, Scratch(es), Smart repair	110,64
---	--------



Door moulding Lower R R, Scratch(es), Smart repair	110,64
--	--------



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Bumper R, Scratch(es), Smart repair

110,64



Bumper grille, Damaged, E - Replace

32,40



Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18



Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R R, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display


Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bonnet, Bad repair, Acceptable

0,00

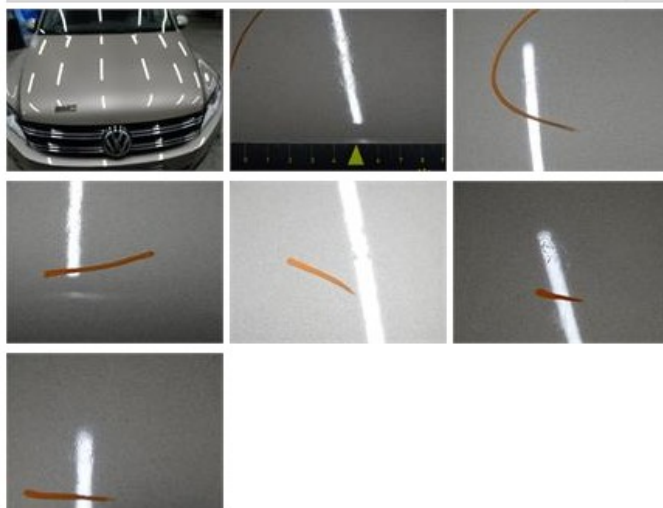

Front bumper, Scratch(es), LI - Repair and paint (complete)

211,80



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Door F L, Scratch(es), LI - Repair and paint (complete)

318,35

