



PEUGEOT 5008: 1FLS449

Vinnnumber:	VF30ARHD8DS117499	Versionname:	5008 Active FAP 136PK
First Registrationdate:	9/08/2013	Fiscalpower:	
Expertise Mileage:	41623	Power Kw:	100
Bodytype:	SUV	Body color:	Light Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2815
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	215/55/16/93 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	1812,77
Roof, Dent(s), PDR - Knock out without painting	63,00

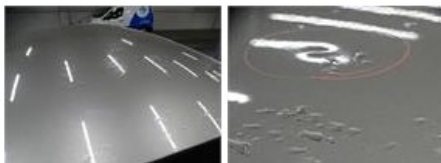

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------






Bumper R, Scratch(es), Acceptable 0,00

No pictures to display


Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

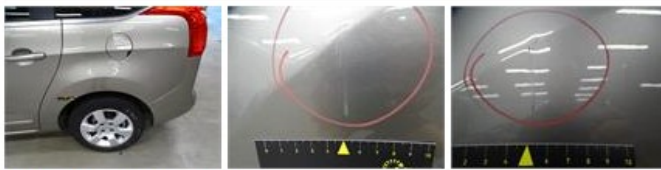

Roof, Bad repair, Acceptable 0,00

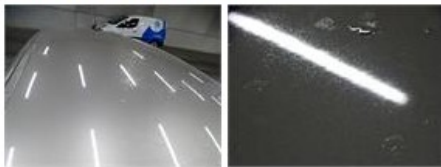

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Wing F L, Crack, Le - Replace and paint 530,02

