



MERCEDES C: 1HHH110

Vinnumber:	WDD2050041F054672	Versionname:	C BER 220 BlueTEC 163PK
First Registrationdate:	23/07/2014	Fiscalpower:	
Expertise Mileage:	146962	Power Kw:	120
Bodytype:	Berline	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2511
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting LED
Type of GPS	GPS big screen color
Type of Lining	Lining artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/94 W LightMetal				
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 2349,71

Shutter / cover, Missing, E - Replace 19,60



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Wing F R, Scratch(es), LI - Repair and paint (complete) 220,18



Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Stone chip(s), LI - Repair and paint (complete) 290,08




Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Seat cover F L, Worn, Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

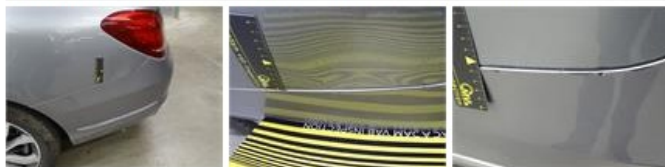

Tyre repair kit, Missing, E - Replace 210,53



Rearlight R , Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Broken, Le - Replace and paint 735,00



Bumper moulding R, Missing, Le - Replace and paint 100,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Floor covering F L, Burned, Smart repair

