



BMW 1: 1WEQ616

Vinnumber:	WBA1S51040V836694	Versionname:	
First Registrationdate:	1/01/2020	Fiscalpower:	
Expertise Mileage:	70094	Power Kw:	
Bodytype:	Hatchback	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1112
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	No		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Seats F heated	
Radio multimedia	
Type of headlighting	Headlighting LED
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

245/40/17/95 W LightMetal				
Summer tyres:	Fr.L.	Other: 0 mm	Fr.R.	Other: 6 mm
	Re.L.	Other: 4 mm	Re.R.	Other: 4 mm

Assistance equipment

Repair kit	No	Compressor	No
Total cost ex VAT			5354,22
Luggage space cover, Damaged, E - Replace			240,00




Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Wing F L, Scratch(es), LI - Repair and paint (complete)

220,18

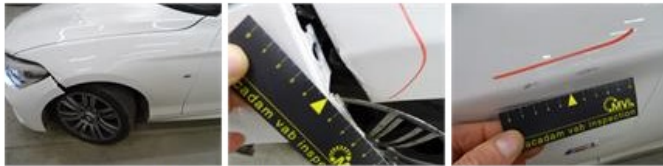

Bumper grille, Broken, E - Replace

32,40



Bumper grille F L, Broken, E - Replace

32,40



Compressor, Missing, E - Replace

0,00

No pictures to display

Bumper F, Broken, Le - Replace and paint

735,00



Alloy rim F R, Not original part, E - Replace

235,20



Tyre F R, Not original part, E - Replace

132,00



Bumper grille F R, Broken, E - Replace

32,40



Door F R, Dent(s), PDR - Paintless dent repair

63,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Ignition key, Missing, E - Replace 150,00

No pictures to display

Roof, Hail damage, PDR - Hail 1575,00



Foglight L, Missing, E - Replace 138,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

LED headlight L, Broken, E - Replace 696,00



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 386,08



Bumper grille F L, Missing, E - Replace 32,40

No pictures to display

Door F L, Dent(s), PDR - Paintless dent repair 63,00



Interior, Dirty, Chemical cleaning

248,58



Interior, Smell, Ozone treatment

152,58

