



VOLKSWAGEN GOLF VII: 1LRF811

Vinnumber:	WVWZZZAUZGP057151	Versionname:	1.6 TDI 81KW TRENDLINE
First Registrationdate:	13/11/2015	Fiscalpower:	
Expertise Mileage:	130513	Power Kw:	81
Bodytype:		Body color:	Blue
Gearbox:	MAN 5 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2714
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Front parking sensors	
Windows electric F		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/15/91 H Steel				
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm

Assistance equipment


Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2375,89
Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)	115,56



Roof, Dent(s) and scratch(es), LI - Repair and paint (complete)

481,50

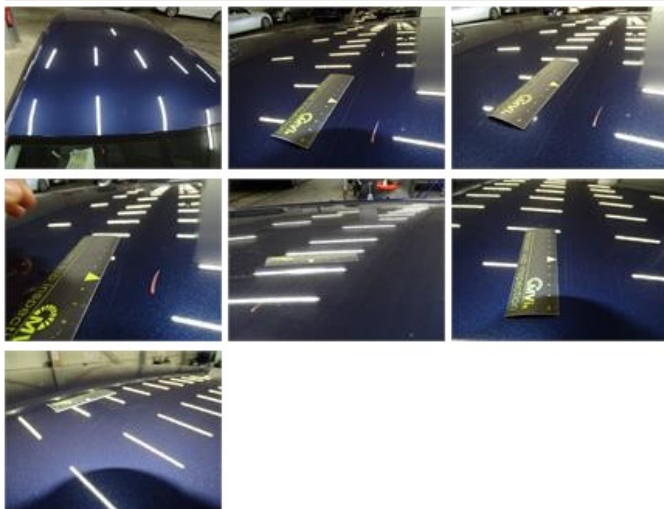

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R R, Scratch(es), 67 - Polish

0,00

No pictures to display

Tailgate, Dent(s), Acceptable

0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace

30,00



Bodywork, Not original part, Acceptable

0,00

No pictures to display

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18



Ignition key, Missing, E - Replace

150,00

No pictures to display

Door R L, Scratch(es), 67 - Polish

0,00

No pictures to display

Wing R L, Scratch(es), 67 - Polish

0,00


wing R L, Scratch(es), 67 - Polish

0,00

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete)

318,35

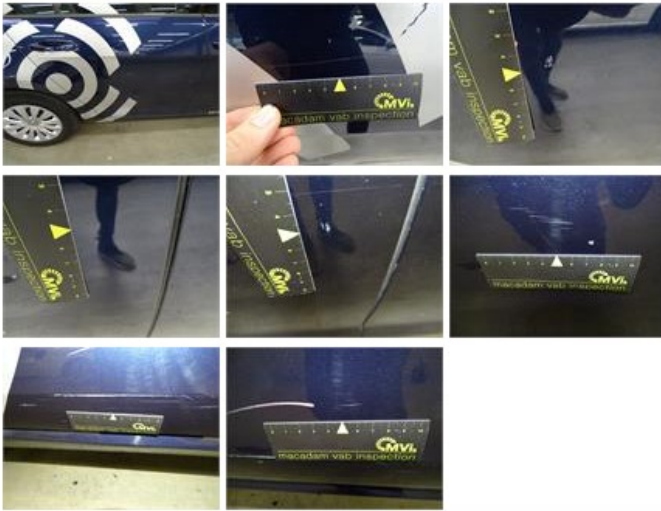

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bonnet, Scratch(es), 67 - Polish

0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Door F R, Scratch(es), LI - Repair and paint (complete)

318,35

