



VOLKSWAGEN POLO: 1LUU063

Vinnnumber:	VWVZZZ6RZGY130176	Versionname:	1.4 TDI 55KW COMFORTLINE BMT
First Registrationdate:	10/12/2015	Fiscalpower:	
Expertise Mileage:	89011	Power Kw:	55
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	LKW2
Maintenance:	OVER 17700 KM		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Radio multimedia	Type of Tow bar
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Autom climate control
	No Tow bar

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	NOT OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

185/60/15/84 H Steel			
Summer tyres:	Fr.L. Pirelli: 7 mm	Fr.R. Pirelli: 7 mm	
	Re.L. Hankook: 7 mm	Re.R. Hankook: 7 mm	

Assistance equipment


Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT 788,44

Wheel cover R R, Missing, Acceptable 0,00



Seat cover R, Stain, Cleaning 50,00

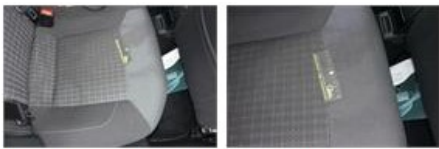

Rear window, Not original part, P - Check

0,00



Tailgate, Scratch(es), Acceptable

0,00



Rearlight R , Broken, E - Replace

96,00



Door R R, Scratch(es), Acceptable

0,00



Rearview mirror housing L, Scratch(es), Acceptable

0,00



Wheel cover F L, Missing, E - Replace

24,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

217,44



Wheel cover F R, Missing, E - Replace

24,00



Roof, Dent(s), PDR - Paintless dent repair

63,00



Seat cover F L, Stain, Cleaning

25,00



Reflector, Missing, E - Replace

19,00



Door panel R R, Scratch(es), E - Replace

96,00



Ignition key, Missing, E - Replace

150,00



Wheel cover R L, Missing, E - Replace

24,00

