



PEUGEOT 308 SW: 1KXY841

Vinnumber:	VF3LCBHXHFS194780	Versionname:	1.6 BLUEHDI 85KW S/S 88G ALLURE
First Registrationdate:	29/07/2015	Fiscalpower:	
Expertise Mileage:	86724	Power Kw:	85
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3702
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Panoramic roof	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	Tow bar removable
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Vredestein: 5 mm	Fr.R.	Vredestein: 5 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2347,02
Floor covering F L, Worn, P - Check	0,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80




Wing R L, Dent(s), PDR - Paintless dent repair

63,00



Alloy rim F R polished, Scratch(es), E - Replace

235,20

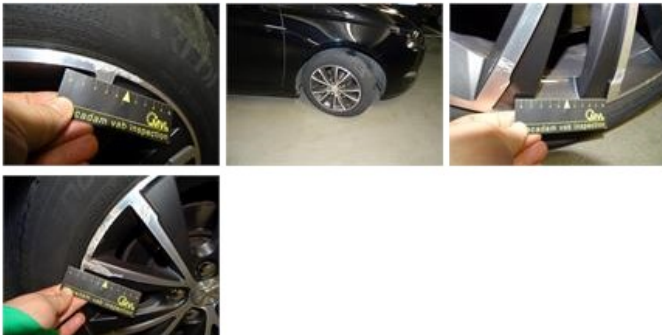

Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50



Alloy rim R R polished, Scratch(es), I - Repair

155,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Ignition key, Missing, E - Replace

150,00



Alloy rim F L polished, Scratch(es), E - Replace

235,20



Seat cover R, Stain, Acceptable 0,00



Door F L, Scratch(es), Acceptable 0,00



Bonnet, Stone chip(s), Acceptable 0,00



Wing F L, Scratch(es), Acceptable 0,00



Alloy rim R L polished, Scratch(es), E - Replace 235,20



Door R R, Scratch(es), It - Spot repair 115,56



Rocker panel inner R R, Scratch(es), Acceptable 0,00



Trunk lid covering R, Scratch(es), Acceptable 0,00



Door R L, Scratch(es), Acceptable 0,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56

