



INFINITI Q50: KP7786

| | | | |
|------------------------------------|--------------------------|--------------|------------------------------------|
| Vinnumber: | JN1BDAV37U0204782 | Versionname: | 2.2D PREMIUM EXECUTIVE AUTO |
| First Registrationdate: | 8/01/2016 | Fiscalpower: | |
| Expertise Mileage: | 156998 | Power Kw: | 125 |
| Bodytype: | | Body color: | Purple |
| Gearbox: | Automatic | Paint type: | Metallic |
| Transmission: | Front | Rims summer: | Aluminium |
| Fueltype: | Diesel | Oil level: | OK |
| Maintenance: | OK | Parking lot: | 4613 |
| Battery functioning: | Yes | | |
| Number of doors: | 4 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Rims summer: | Aluminium | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | |
|--------------------------------|----------------------------------|
| Radio CD | Sun Roof electric |
| Windows electric F | Central consol F |
| Windows electric R | Front parking sensors |
| Cruise Control | Rear parking sensors |
| Steering wheel multifunctional | |
| Seats F heated | |
| Type of headlighting | Headlighting LED |
| Type of GPS | GPS big screen color |
| Type of Lining | Lining artificial leather |
| Type of climate control | Autom climate control |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | OK |
| | | Wiperblades | OK |

Degree of wear

| | | | | |
|---------------|-----------------------------------|-----------------------|-------|-----------------------|
| | 225/55/17/92 MS LightMetal | | | |
| Winter tyres: | Fr.L. | Michelin: 4 mm | Fr.R. | Michelin: 4 mm |
| | Re.L. | Michelin: 5 mm | Re.R. | Michelin: 5 mm |

Assistance equipment

| | |
|---------------------------------------------------------|---------------|
| Total cost ex VAT | 732,80 |
| Bumper F, Scratch(es), LI - Repair and paint (complete) | 211,80 |



Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Hail damage, PDR - Hail 125,00




Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Windscreen, Repaired, Acceptable 0,00



Roof, Hail damage, PDR - Hail 125,00

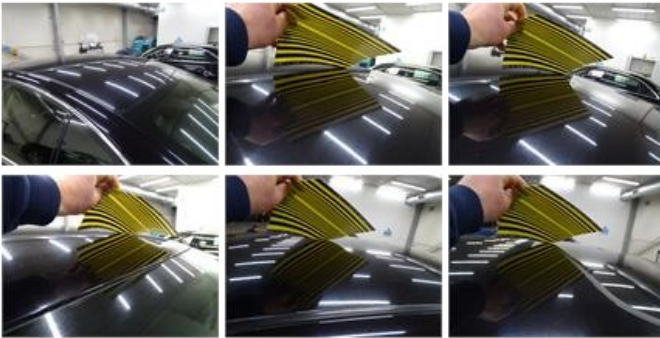

Gear shift lever knob, Scratch(es), E - Replace 114,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), Acceptable 0,00

No pictures to display

Covering interior A pillar L, Burned, E - Replace 62,00

