



BMW SERIE 3: 1HPF879

Vinnumber:	WBA3D11080P700004	Versionname:	318d
First Registrationdate:	4/09/2014	Fiscalpower:	
Expertise Mileage:	191003	Power Kw:	100
Bodytype:	Berline	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	SERVICE -1100 KM	Parking lot:	3325
Maintenance:	NOT OK		
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
GPS storage	HD Rear parking sensors
GPS storage	
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control
Level control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/60/16/92 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2199,19
-------------------	----------------

Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	-------------



Grill, Broken, E - Replace	95,24
----------------------------	--------------



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Door F L, Scratch(es), Acceptable

0,00



Maintenance book, Missing, P - Check

0,00



Inner door handle R R, Scratch(es), Acceptable

0,00



Bonnet, Bump(s), PDR - Knock out without painting

63,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Brand badge, Strained , E - Replace

43,09







Door R R, Bump(s), PDR - Knock out without painting 63,00



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 307,80

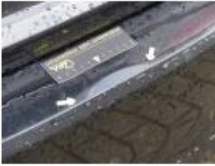

Door F R, Scratch(es), Acceptable 0,00

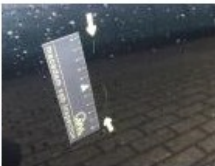

Wing R R, Scratch(es), Acceptable 0,00



Door panel F R, Damaged, Smart repair 110,64



Maintenance, Maintenance, Execute 0,00



Interior, Stain, Chemical cleaning 72,00





Wing F R, Bump(s), LI - Repair and paint (complete) 292,18



Grill, Broken, E - Replace 95,24



Front end, Accident, P - Check 0,00



Alloy rim F L, Scratch(es), Acceptable 0,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00



Tyre F L, Tear, E - Replace 132,00



Centre console, Scratch(es), Acceptable 0,00



Front bumper, Broken, Le - Replace and paint

735,00

