


**AUDI A3: 1DHP382**

Vinnnumber:	<b>WAUZZ8P8CA150968</b>	Versionname:	<b>A3 SB Ambition Start/Stop</b>
First Registrationdate:	<b>21/05/2012</b>	Fiscalpower:	<b>DPF 136PK</b>
Expertise Mileage:	<b>117689</b>	Power Kw:	<b>100</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2512</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD		Sun Roof electric	
GPS storage	<b>HD</b>	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>NOT OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		

**Degree of wear**

<b>225/45/17/91 W LightMetal</b>				
Summer tyres:	Fr.L.	<b>Bridgestone: 7 mm</b>	Fr.R.	<b>Bridgestone: 7 mm</b>
	Re.L.	<b>Hankook: 4 mm</b>	Re.R.	<b>Hankook: 4 mm</b>

**Assistance equipment**

Repair kit	<b>No</b>	Compressor	<b>Yes</b>
------------	-----------	------------	------------


 Total cost ex VAT 2017,77

 Tyre repair kit, Missing, E - Replace 50,00

 Bumper moulding F R, Broken, E - Replace 14,40



Floor covering R, Stain, Cleaning 15,00

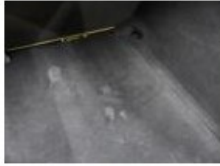

Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Foglight R, Broken, E - Replace 138,00



Inner seat cover R, Broken, E - Replace 12,00



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00






















Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Bump(s), Acceptable 0,00

No pictures to display

No pictures to display	0,00
	0,00
Windscreen, Scratch(es), Acceptable	0,00
 	244,18
Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	244,18
   	114,40
Backrest cover F R, Damaged, E - Replace	114,40
  	89,40
Armrest F Mid, Damaged, E - Replace	89,40
 	49,00
Bumper grille F R, Missing, E - Replace	49,00
Door R L, Bump(s), Acceptable	0,00
No pictures to display	0,00
Roof, Scratch(es), Acceptable	0,00
 	0,00
Backrest cover F L, Damaged, E - Replace	114,40
 	114,40
Luggage space cover, Unclamped, Repair/replace (lump sum)	10,00
	10,00
Headlight R, Scratch(es), 67 - Polish	55,19
 	55,19
Interior, Dirty, Acceptable	0,00

