



CITROEN BERLINGO: 1LDL285

Vinnumber:	VF77B9HF0EJ877670	Versionname:	BERLINGO
First Registrationdate:	28/08/2015	Fiscalpower:	
Expertise Mileage:	73099	Power Kw:	66
Bodytype:		Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3212
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Type of Tow bar	Tow bar fixed
Windows electric F		
Type of headlighting	Headlighting Halogen	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	195/65/15/91 T Steel			
Winter tyres:	Fr.L.	Vredestein: 4 mm	Fr.R.	Vredestein: 4 mm
	Re.L.	Vredestein: 5 mm	Re.R.	Vredestein: 5 mm

Assistance equipment


Spare wheel	Yes	Jack	No
-------------	------------	------	-----------

Total cost ex VAT	841,52
-------------------	---------------


Wheel covers (all), Scratch(es), Acceptable	0,00
---	-------------

No pictures to display

Spare Tyre, Hole, E - Replace	105,00
-------------------------------	---------------

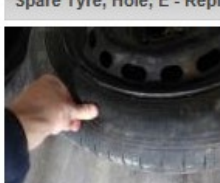

Wing F R, Bump(s), Acceptable	0,00
-------------------------------	-------------

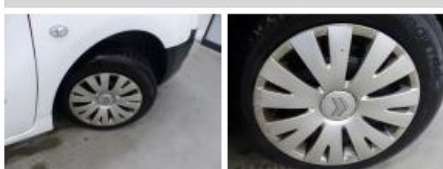

Engine, Maintenance, Execute	0,00
------------------------------	-------------

No pictures to display

Rearlight R, Crack, E - Replace	91,50
---------------------------------	--------------



Dashboard, Missing, Forfeit 25,00



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F L, Scratch(es), E - Replace 22,50



Jack, Missing, E - Replace 42,00



Protection plate M, Tear, E - Replace 123,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Dirty, Cleaning 48,00



Wheel cover F R, Scratch(es), E - Replace 22,50

No pictures to display

Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete) 362,02

