




<b>CITROEN C3: 1DKJ055</b>			
Vinnumber:	<b>VF7SCHFV0CA542627</b>	Versionname:	<b>C3 BER Seduction 60PK</b>
First Registrationdate:	<b>8/06/2012</b>	Fiscalpower:	
Expertise Mileage:	<b>60003</b>	Power Kw:	<b>44</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Petrol</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2823</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

<b>Options</b>	
Radio CD	Luggage cover
Windows electric F	
Type of headlighting	<b>Headlighting Halogen</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Manual climate control</b>

<b>Limited Technical Inspection</b>			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		

<b>Degree of wear</b>				
	<b>185/65/15/88 T Steel</b>			
Summer tyres:	Fr.L.	<b>Michelin: 6 mm</b>	Fr.R.	<b>Michelin: 6 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

<b>Assistance equipment</b>			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Total cost ex VAT	2890,82		
Wheel cover F R, Scratch(es), E - Replace	24,00		

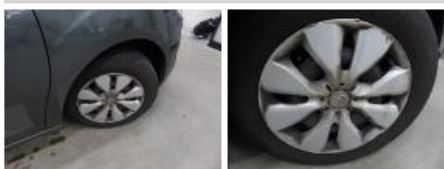

Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Floor covering F L, Damaged, Smart repair	64,32



Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)	115,56
--	--------



Grill, Broken, E - Replace 148,00



Roof, Bump(s), Acceptable 0,00

No pictures to display

Wing F L, Bump(s), LI - Repair and paint (complete) 224,14



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 374,68



Wheel cover F L, Scratch(es), E - Replace 24,00



Wheel covers (all), Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 169,44



Seat cover R L, Stain, Cleaning 15,00



Rearview mirror basis L, Strained , Acceptable 0,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 302,68



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 342,56



Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 254,68



Bumper moulding R, Bump(s), E - Replace 50,00



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 246,56



Bumper R, Broken, Le - Replace and paint 535,20

