


FORD Focus: 1FER141

Vinnumber:	WF0KXXGCBKDB70260	Versionname:	EConetic Trend 88g 105PK
First Registrationdate:	10/06/2013	Fiscalpower:	
Expertise Mileage:	134627	Power Kw:	77
Bodytype:	Break	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance	OK		
Maintenance	SERVICE GEDAAN OP 126000 KM		
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	No		

Options

Radio CD		Luggage cover
GPS storage	SD	Rear parking sensors
GPS storage		
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

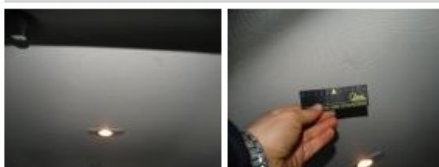
Degree of wear

	205/55/16/91 H Steel			
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Vredestein: 7 mm	Re.R.	Vredestein: 7 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT 973,48

Ceiling, Stain, Cleaning 50,00

Seat cover F R, Hole, E - Replace
360,00



Wing R R, Bump(s), LI - Repair and paint (complete)	356,20
---	--------



Wing F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Front bumper, Scratch(es), Acceptable	0,00
---------------------------------------	------

No pictures to display

Door R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Interior, Smell, Ozone treatment	152,58
----------------------------------	--------

No pictures to display

Storage compartment housing, Incomplete, E - Replace	29,70
--	-------



Seat cover F L, Stain, Cleaning	25,00
---------------------------------	-------



Windscreen, Stone chip(s), Acceptable	0,00
---------------------------------------	------

No pictures to display