



RENAULT Grand Scenic: 1FRU863

Vinnumber:	VF1JZ14M649779300	Versionname:	GRAND SCENIC Bose Ed.5pl.110PK
First Registrationdate:	4/10/2013	Fiscalpower:	
Expertise Mileage:	76660	Power Kw:	81
Bodytype:	Hatchback	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2828
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	NOT OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/55/17/95 V LightMetal			
Summer tyres:	Fr.L.	Continental: 7 mm	Fr.R.	Continental: 7 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Compressor	Yes
------------	------------

Total cost ex VAT	5979,26
-------------------	----------------

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------






Rocker panel inner R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	115,56
---	---------------



Wing R L, Hail damage, PDR - Hail	125,00
-----------------------------------	---------------

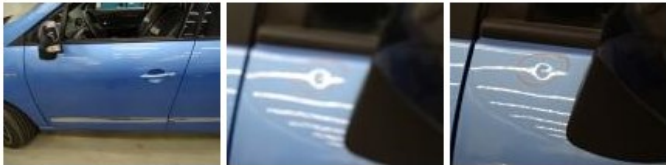

<input checked="" type="checkbox"/>	Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Seat cover F L, Dirty, Cleaning	12,00
<input checked="" type="checkbox"/>	Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Wing R R, Hail damage, PDR - Hail	25,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Seat cover F L, Worn, Acceptable	0,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Tailgate, Hail damage, PDR - Hail	150,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Roof pillar R, Hail damage, PDR - Hail	125,00
<input checked="" type="checkbox"/>	Door R L, Hail damage, PDR - Knock out without painting	82,80
	Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Roof, Hail damage, PDR - Hail	3250,00
	Door F R, Bump(s), PDR - Knock out without painting	63,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Roof pillar L, Hail damage, PDR - Hail	300,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	Door F L, Hail damage, PDR - Knock out without painting	122,40
	Bonnet, Damaged, Le - Replace and paint	1016,70
