



VOLKSWAGEN GOLF BREAK: 1DNG247

Vinnumber:	WVWZZZ1KZBM621502	Versionname:	
First Registrationdate:		Fiscalpower:	
Expertise Mileage:	183969	Power Kw:	77
Bodytype:	Break	Body color:	Light Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4305
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Luggage cover	
Windows electric F			
Windows electric R			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/55/16/91 H Steel			
Winter tyres:	Fr.L.	Continental: 7 mm	Fr.R.	Continental: 7 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1155,56
-------------------	----------------


Door R R, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

No pictures to display

Wheel cover R R, Scratch(es), E - Replace	30,00
---	--------------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	---------------

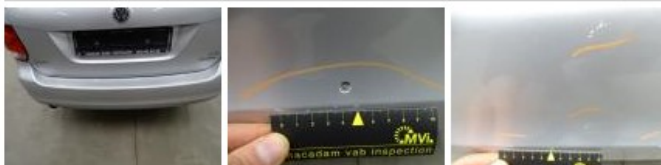



Wheel cover F R, Scratch(es), E - Replace 30,00



Wing R R, Bump(s), LI - Repair and paint (complete) 308,20



Wheel cover R L, Scratch(es), E - Replace 30,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Roof pillar L, Scratch(es), It - Spot repair 115,56



Headrest R R, Missing, E - Replace 60,00



Rear window, Scratch(es), E - Replace 370,00

