



PEUGEOT 308: 1FE186

Vinnumber:	VF34H9HD8DS068429	Versionname:	308 SW e-HDi Active STT
First Registrationdate:	6/06/2013	Fiscalpower:	115PK
Expertise Mileage:	130463	Power Kw:	84
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3706
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Panoramic roof	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Type of headlighting	Headlighting Halogen	Rear parking sensors	
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Pirelli: 2 mm	Fr.R.	Pirelli: 2 mm
	Re.L.	Pirelli: 2 mm	Re.R.	Pirelli: 2 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	2007,48
Front bumper, Damaged, Le - Replace and paint	735,00



Headlight R, Broken, E - Replace	396,00
----------------------------------	--------



Wing R L, Bump(s), PDR - Knock out without painting	63,00
---	-------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------




Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Tailgate, Bump(s), LI - Repair and paint (complete)	301,68
---	--------

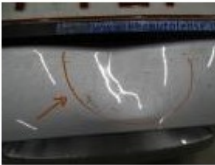

Door trim R L, Scratch(es), It - Spot repair	110,00
--	--------

