



OPEL Astra: 1DLK518

Vinnumber:	W0LPC6DAXC1123216	Versionname:	ASTRA BER EcoFLEX Essentia St/S DPF 95PK
First Registrationdate:	15/06/2012	Fiscalpower:	
Expertise Mileage:	115033	Power Kw:	70
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4525
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover
Windows electric F		
Type of headlighting	Headlighting Halogen	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		


Degree of wear

	205/60/16/92 V Steel			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Spare tyre compact	Yes
--------------------	------------

Total cost ex VAT	1744,96
Wing F L, Bump(s) and scratch(es), LI - Repair and paint (complete)	220,18

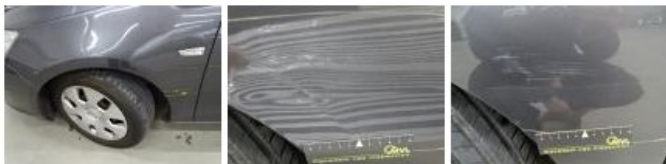

Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	---------------





Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35




Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20



Interior, Dirty, Cleaning 48,00



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

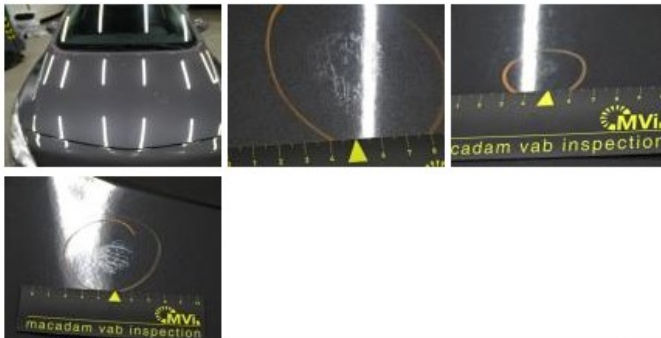

Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80



Wheel cover R R, Scratch(es), E - Replace 30,00

