



PEUGEOT 508: 1EGH391

Vinnnumber:	VF38E9HD8CL077888	Versionname:	508 SW e-HDi Active BMP 115PK Aut.
First Registrationdate:	23/11/2012	Fiscalpower:	
Expertise Mileage:	156742	Power Kw:	84
Bodytype:	Break	Body color:	Blue
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3815
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Panoramic roof	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		
Head-up Display			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	215/60/16/99 H LightMetal			
Winter tyres:	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Dunlop: 6 mm	Re.R.	Dunlop: 6 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1083,80
-------------------	----------------

Bonnet, Scratch(es), Acceptable	0,00
---------------------------------	-------------

No pictures to display

Door F L, Repaired, Acceptable	0,00
--------------------------------	-------------





Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Bad repair, Acceptable 0,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20




Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Stain, Cleaning 25,00



Bumper spoiler F, Scratch(es), E - Replace 42,00

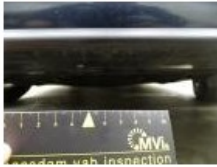

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Roof, Bump(s), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Outer backrest protection L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Bad repair, Acceptable 0,00



Bumper R, Damaged, LI - Repair and paint (complete) 211,80

