



**RENAULT Megane: XP4354**

Vinnumber:	<b>VF1KZ140649687159</b>	Versionname:	<b>MEGANE GT Energy Business 110PK</b>
First Registrationdate:	<b>11/11/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>191592</b>	Power Kw:	<b>81</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2513</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD		Sun Roof electric
GPS storage	<b>SD</b>	Panoramic roof
GPS storage		Central consol F
Windows electric F		Luggage cover
Windows electric R		Rear parking sensors
Cruise Control		
Steering wheel multifunctional		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		

**Degree of wear**


<b>195/65/15/91 V Steel</b>				
Summer tyres:	Fr.L.	<b>Continental: 4 mm</b>	Fr.R.	<b>Continental: 4 mm</b>
	Re.L.	<b>Continental: 4 mm</b>	Re.R.	<b>Continental: 4 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	<b>399,20</b>
-------------------	---------------

Interior, Dirty, Forfeit	<b>50,00</b>
--------------------------	--------------

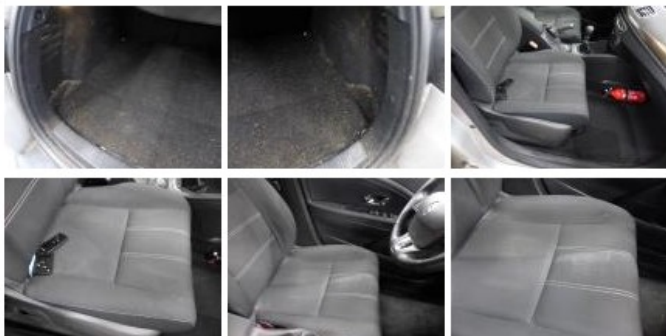



Bumper grille, Incomplete, E - Replace 32,40



Wing R R, Bump(s), Acceptable 0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace 30,00



Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Wheel cover F L, Scratch(es), E - Replace 30,00



Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Engine protective plate, Tear, E - Replace 45,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display