




AUDI A1: 1EFQ019			
Vinnumber:	WAUZZZ8X8DB051501	Versionname:	A1 BER Ambition
First Registrationdate:	19/11/2012	Fiscalpower:	Start/Stop DPF 105PK
Expertise Mileage:	135073	Power Kw:	77
Bodytype:	Berline	Body color:	Dark Blue
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1108
Number of doors:	3		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	SD Rear parking sensors
Windows electric F	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear			
Winter tyres:	215/45/16/86 H LightMetal		
	Fr.L.	Fr.R.	Pirelli: 4 mm
	Re.L.	Re.R.	Pirelli: 4 mm

Assistance equipment	
Repair kit	Yes
Compressor	Yes
Total cost ex VAT	1038,18
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00

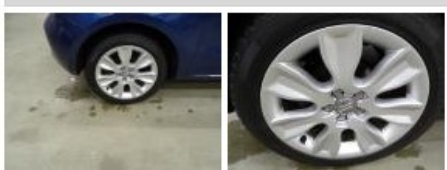

Luggage space cover, Missing, E - Replace	192,00
---	--------



	192,00
--	--------

Front bumper, Scratch(es), LI - Repair and paint (complete) 169,44




Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 232,06

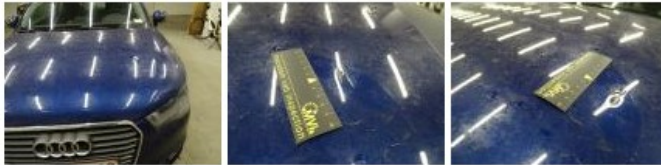

Door F L, Scratch(es), LI - Repair and paint (complete) 254,68



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display