




BMW X5: 1GPJ253			
Vinnnumber:	<b>WBAKS210500H96306</b>	Versionname:	<b>X5 2.0dA xDrive25 211PK Aut.</b>
First Registrationdate:	<b>25/03/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>149283</b>	Power Kw:	<b>155</b>
Bodytype:	<b>SUV</b>	Body color:	<b>Black</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metallic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3504</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

Options	
Radio CD	Luggage cover
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Seats F heated	
Type of headlighting:	<b>Headlighting Xenon</b>
Type of GPS:	<b>GPS big screen color</b>
Type of Lining:	<b>Lining leather</b>
Type of climate control:	<b>Autom climate control</b>

Limited Technical Inspection			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		

Degree of wear				
Winter tyres:	<b>255/55/18/109 H LightMetal</b>			
	Fr.L.	<b>Continental: 6 mm</b>	Fr.R.	<b>Continental: 6 mm</b>
	Re.L.	<b>Continental: 6 mm</b>	Re.R.	<b>Continental: 6 mm</b>

Assistance equipment	
Runflat	<b>Yes</b>
Total cost ex VAT	<b>1457,40</b>
Door R R, Chemical polution, LI - Repair and paint (complete)	<b>382,02</b>

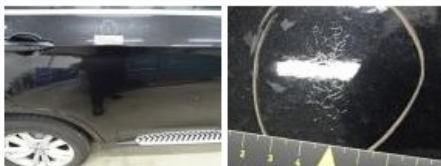


Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	<b>382,02</b>
---	---------------



Bumper R, Bump(s), Acceptable	<b>0,00</b>
-------------------------------	-------------

No pictures to display

Roof, Damaged, LI - Repair and paint (complete) 577,80

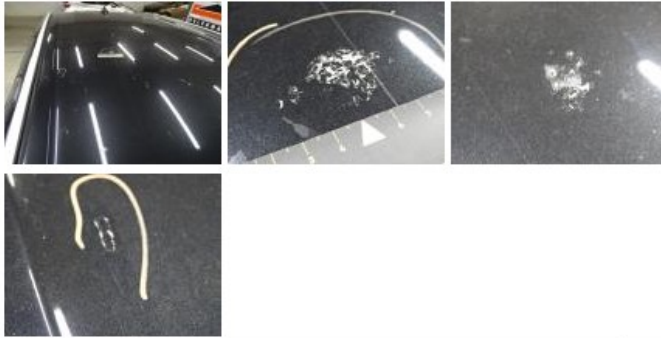

Rearview mirror housing R, Damaged, LI - Repair and paint (complete) 115,56

