



AUDI A4 Allroad: 1FLQ199

Vinnnumber:	WAUZZ8KXEA030919	Versionname:	A4 ALLROAD Quattro S-tr.163PK Aut.
First Registrationdate:	8/08/2013	Fiscalpower:	
Expertise Mileage:	158865	Power Kw:	120
Bodytype:		Body color:	White
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	4 Weel	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2426
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	225/55/17/97 Y LightMetal			
Summer tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm

Assistance equipment

Spare tyre compact	Yes	Jack	Yes
--------------------	------------	------	------------

Total cost ex VAT 1274,20

Bumper cover R M, Damaged, E - Replace 385,20



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper spoiler F, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Stone chip(s), Acceptable 0,00

No pictures to display

Windscreen, Stone chip(s), E - Replace 487,20



Boot carpet, Worn, P - Check 0,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Door frame F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Stone chip(s), Acceptable 0,00


No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



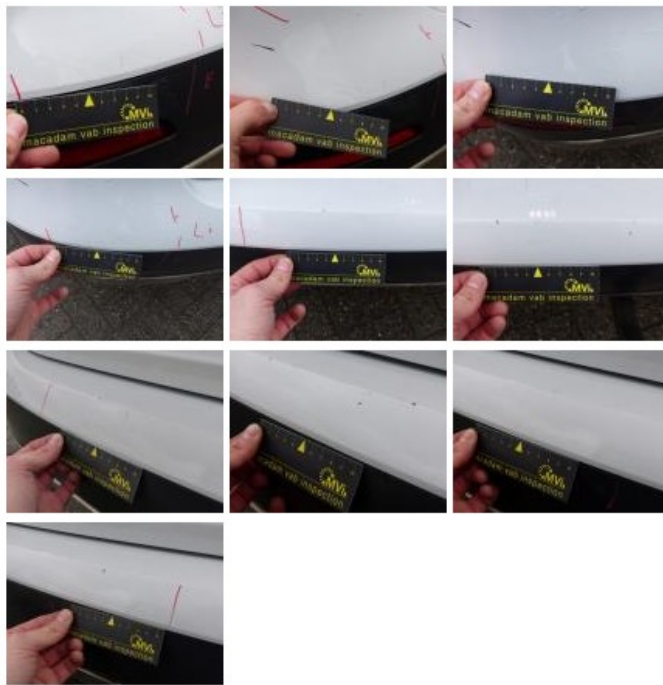

Wing trim R R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Towhook (removable), Not original part, P - Check	0,00
---	------



Internal Boot Lining L, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Outer door handle F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Trunk lid covering R, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Internal Boot Lining R, Scratch(es), Acceptable	0,00
---	------

No pictures to display