


**MERCEDES A: 1GCZ123**

Vinnumber:	<b>WDD1760121J231319</b>	Versionname:	<b>A 180CDI BE Edition 109PK</b>
First Registrationdate:	<b>3/01/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>170304</b>	Power Kw:	<b>80</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1626</b>
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R			
Steering wheel multifunctional			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Manual climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		

**Degree of wear**

	<b>195/65/15/91 T Steel</b>			
Winter tyres:	Fr.L.	<b>Kleber: 7 mm</b>	Fr.R.	<b>Kleber: 7 mm</b>
	Re.L.	<b>Kleber: 5 mm</b>	Re.R.	<b>Kleber: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	2662,00
Door F R, Scratch(es), LI - Repair and paint (complete)	318,35



Wing R R, Bump(s), Acceptable	0,00
-------------------------------	------

*No pictures to display*

Wheel cover F R, Scratch(es), E - Replace	30,00
---	-------





Bonnet, Scratch(es), LI - Repair and paint (complete)	290,08
---	--------




Rocker panel inner R R, Bump(s) and scratch(es), LI - Repair and paint (complete)

115,56

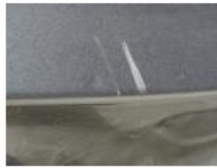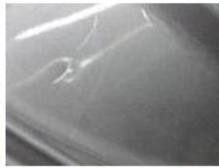

Door R R, Bump(s), LI - Repair and paint (complete)

318,35

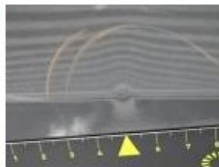

Roof, Bump(s), PDR - Knock out without painting

63,00




Wheel cover R R, Scratch(es), E - Replace

30,00



Wing F R, Scratch(es), LI - Repair and paint (complete)

220,18

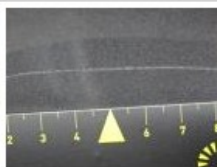

Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Wheel cover R L, Scratch(es), E - Replace

30,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Tailgate, Bump(s) and scratch(es), Le - Replace and paint

1034,68



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

