



RENAULT Laguna: 1EQM85			
Vinnumber:	VF1KT1RG648532351	Versionname:	LAGUNA BRE ECO2 champ.Bus.FAP 110PK
First Registrationdate:	21/02/2013	Fiscalpower:	
Expertise Mileage:	234056	Power Kw:	81
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2109
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining artificial leather and alcantara
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	NOT OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear				
	205/60/16/92 H LightMetal			
Summer tyres:	Fr.L.	Continental: 3 mm	Fr.R.	Continental: 3 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm

Assistance equipment			
Spare wheel	Yes	Jack	Yes

Total cost ex VAT	1519,28
Door R L; Bump(s) and scratch(es), Le - Replace and paint	0,00



Wing R R; Bump(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	---------------



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00




Wing R L, Bump(s), LI - Repair and paint (complete) 308,20



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 290,08

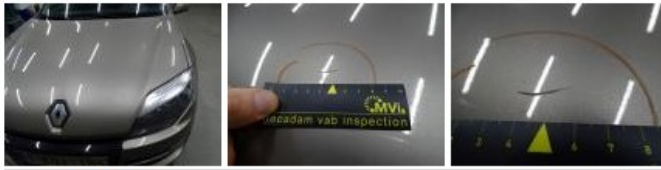

Interior, Dirty, Cleaning 96,00



Door F L, Incomplete, E - Replace 20,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

