



MERCEDDES C: 1FAE807			
Vinnnumber:	WDD2040001A861504	Versionname:	C BER 180 CDI BlueEFF. S&S 120PK
First Registrationdate:	6/05/2013	Fiscalpower:	
Expertise Mileage:	60203	Power Kw:	88
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2602
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Luggage cover
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Type of headlighting:	Headlighting Halogen
Type of Lining:	Lining fabrics
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear				
	195/60/16/89 H LightMetal			
Winter tyres:	Fr.L.	Pirelli: 5 mm	Fr.R.	Pirelli: 5 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm

Assistance equipment			
Spare wheel	Yes	Jack	Yes

Total cost ex VAT	2076,53
Full screen GPS, Missing, E - Replace	200,00



Door R L, Scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display	
Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80



Certificate Of Conformity, Missing, E - Replace	150,00
---	--------

No pictures to display

Wing R L, Scratch(es), LI - Repair and paint (complete)	308,20
---	--------




Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------




Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
---	--------

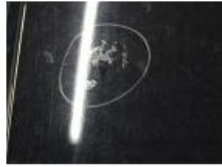

Roof, Chemical polution, LI - Repair and paint (complete)	481,50
---	--------

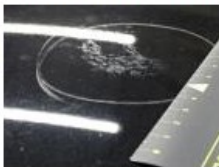

Seat cover R L, Dirty, Cleaning	21,60
---------------------------------	-------

