



BMW 4 GRAN COUPE: LK5813

Vinnnumber:	WBA4E71080G519120	Versionname:	2.0 418D (110KW) GRAN COUPE
First Registrationdate:	4/02/2016	Fiscalpower:	
Expertise Mileage:	101160	Power Kw:	110
Bodytype:		Body color	Dark Blue
Gearbox:	Automatic	Paint type	Metalic
Transmission:	Back	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1224
Number of doors	5		
Number of seats	5		
Number head rests	4		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD Front parking sensors
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining leather

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/60/16/92 H LightMetal			
Winter tyres:	Fr.L.	Dunlop: 6 mm	Fr.R.	Dunlop: 6 mm
	Re.L.	Dunlop: 5 mm	Re.R.	Dunlop: 5 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1436,22
-------------------	----------------



Door F L, Bump(s), Acceptable	0,00
-------------------------------	-------------

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete)	254,16
---	---------------

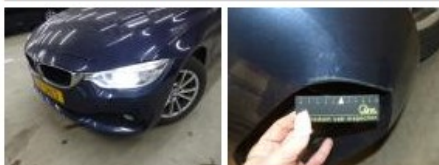

Door F R, Bump(s), PDR - Knock out without painting	142,20
---	---------------

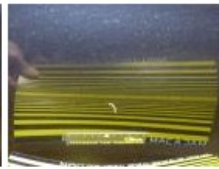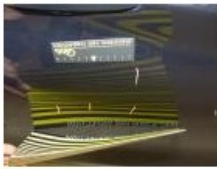

Tailgate, Bump(s), Acceptable	0,00
-------------------------------	------

No pictures to display

Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	478,02
---	--------



Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	561,84
---	--------

