



RENAULT Megane: 1FPC565			
Vinnnumber:	VF1EZ090E49429586	Versionname:	MEGANE CC GT-Line EDC 110PK Aut.
First Registrationdate:	12/09/2013	Fiscalpower:	
Expertise Mileage:	108565	Power Kw:	81
Bodytype:	Cabriolet	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2204
Number of doors:	2		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Panoramic roof
Windows electric F	Central consol F
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining leather
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear			
Winter tyres:	205/50/17/93 V LightMetal		
	Fr.L.	Fr.R.	Michelin: 6 mm
	Re.L.	Re.R.	Michelin: 6 mm

Assistance equipment			
Spare wheel	Yes	Jack	Yes
Total cost ex VAT			936,55
Alloy rim F L, Scratch(es), LI - Repair and paint (complete)			95,00



Bumper R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)		95,00



Seat cover R R, Dirty, Cleaning 25,00



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display


Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Bump(s), LI - Repair and paint (complete) 308,20

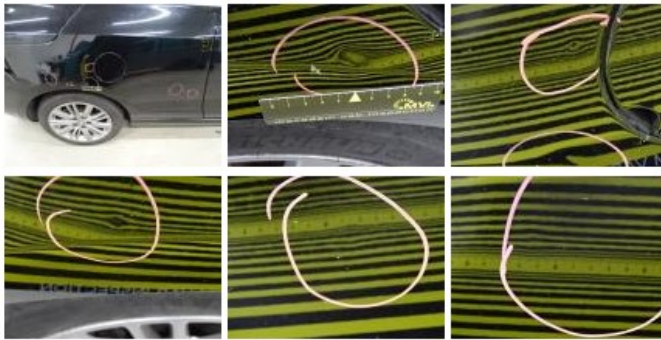

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

