



VOLKSWAGEN Golf: 1ELW780			
Vinnumber:	WVWZZZ1KZDM651271	Versionname:	GOLF BRE Trendline BlueMot.DPF 105PK
First Registrationdate:	17/01/2013	Fiscalpower:	
Expertise Mileage:	155861	Power Kw:	77
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3623
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		


Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Type of headlighting:	Headlighting Halogen
Type of Lining:	Lining fabrics
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear			
Winter tyres:	205/55/16/91 H LightMetal		
	Fr.L.	Fr.R.	Re.R.
	Michelin: 5 mm	Michelin: 5 mm	Firestone: 7 mm
	Re.L.	Re.R.	Firestone: 7 mm

Assistance equipment			
Spare wheel	Yes	Jack	Yes

Total cost ex VAT	933,35
Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	308,20

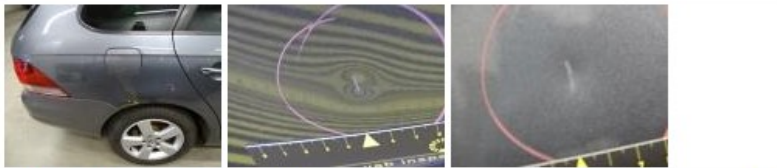

Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display
 Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------

