

**VOLVO V60: 1FRV270**

Vinnnumber:	YV1FW8481E1163520	Versionname:	1.6 D2 Kinetic
First Registrationdate:	4/10/2013	Fiscalpower:	
Expertise Mileage:	155289	Power Kw:	84
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	SERVICE DANS 9693 KM	Parking lot:	3112
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		
Adaptive cruise control			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/60/16/96 H LightMetal			
Winter tyres:	Fr.L.	Vredestein: 5 mm	Fr.R.	Vredestein: 5 mm
	Re.L.	Toyo: 7 mm	Re.R.	Toyo: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			927,74
Interior, No damage, P - Check			0,00



Alloy rim R R, Scratch(es), Acceptable

0,00



Wing F R, Scratch(es), LI - Repair and paint (complete) 220,18



Bonnet, Scratch(es), Acceptable 0,00



Door F L, Bump(s) and scratch(es), Acceptable 0,00



Door panel F L, Scratch(es), Acceptable 0,00



Door panel R L, Scratch(es), Acceptable 0,00



Central pillar L, Scratch(es), Acceptable 0,00



Bumper R, Bump(s) and scratch(es), Acceptable 0,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 332,20






Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete) 259,80



Headlight R, Scratch(es), Acceptable 0,00



Fuel cap cover, Scratch(es), Paint 115,56

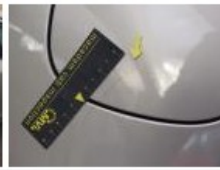

Door R R, Scratch(es), Acceptable 0,00

