



MERCEDES C 220 CDI: 1GFM152

Vinnnumber:	WDD2040021A930267	Versionname:	C BER 220CDI BE Edition Avantgarde 163PK
First Registrationdate:	24/01/2014	Fiscalpower:	
Expertise Mileage:	182741	Power Kw:	120
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	SERVICE B1 IN 17500KM	Parking lot:	3828
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Seats electric F L
GPS storage	Seats electric F R
GPS storage	HD
Windows electric F	Central consol F
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining semi-artificial leather
Type of climate control:	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm

Assistance equipment

Spare tyre compact	Yes	Jack	Yes
--------------------	------------	------	------------

Total cost ex VAT	2108,24
-------------------	---------

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Rearview mirror housing R, Broken, Le - Replace and paint 171,50



Outer door handle F R, Scratch(es), Paint 115,56



Bumper Trim F, Crack, E - Replace 172,35



Windscreen, Repaired, P - Check 0,00




Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00

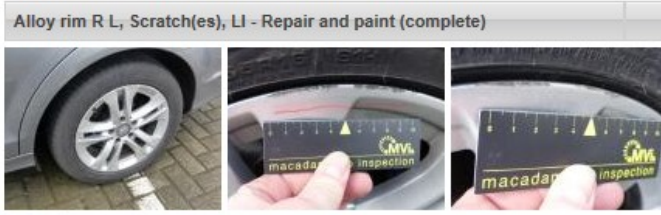

Bumper Trim F, Stone chip(s), E - Replace 172,35

Bumper trim F, Stone chip(s), E - Replace 17,99



Interior, Worn, Acceptable 0,00



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35



Rearview mirror basis R, Broken, E - Replace 36,18



Tailgate, Bump(s), Acceptable 0,00

No pictures to display