



JAGUAR XF: 1GQI778			
Vinnumber:	<b>SAJAA05D8EDU31104</b>	Versionname:	<b>XF BER 163PK Aut.</b>
First Registrationdate:	<b>1/04/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>169812</b>	Power Kw:	<b>120</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Dark Red</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>4824</b>
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

Options	
Windows electric F	Seats electric F L
Windows electric R	Seats electric F R
Cruise Control	Central consol F
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Radio multimedia	
Type of headlighting	<b>Headlighting Xenon</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining leather</b>
Type of climate control	<b>Autom climate control</b>

Limited Technical Inspection			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		


Degree of wear				
Winter tyres:	<b>245/45/18/100 V LightMetal</b>			
	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 7 mm</b>	Re.R.	<b>Michelin: 7 mm</b>

Assistance equipment			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>

Total cost ex VAT	<b>1479,95</b>
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	<b>95,00</b>



Door R R, Scratch(es), LI - Repair and paint (complete)	<b>382,02</b>
---	---------------

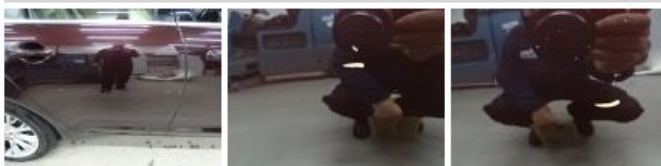



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Damaged, E - Replace 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Dirty, Cleaning 0,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 348,09



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 369,84



