



VOLKSWAGEN Crafter 35 MWB: 257BFP

Vinnnumber:	WV1ZZZ2FZA7003669	Versionname:	CRAFTER 35 LB2C MWB
First Registrationdate:	7/01/2010	Fiscalpower:	109PK
Expertise Mileage:	214717	Power Kw:	80
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Back	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV29
Number of doors:	4		
Number of seats:	7		
Number head rests:	5		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD	Type of Tow bar	Tow bar fixed
Windows electric F		
Type of headlighting	Headlighting Halogen	
Type of Lining	Lining artificial leather	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	235/65/16/115 R Steel			
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm

Assistance equipment


Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	912,77
-------------------	---------------


Seat cover F L, Worn, Acceptable	0,00
----------------------------------	-------------

No pictures to display

Door R R, Rust, Acceptable	0,00
----------------------------	-------------

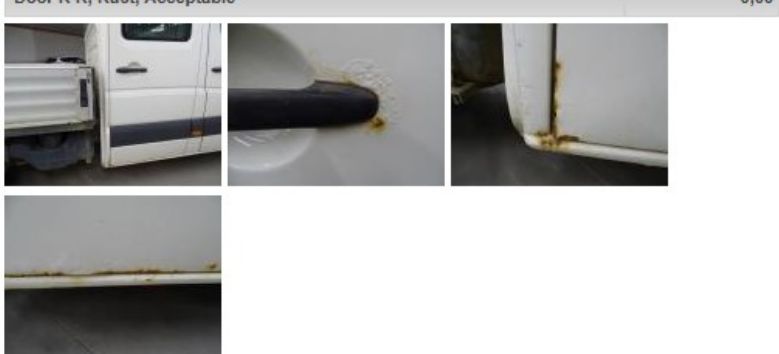

Door R L, Rust, LI - Repair and paint (complete)	238,76
--	---------------

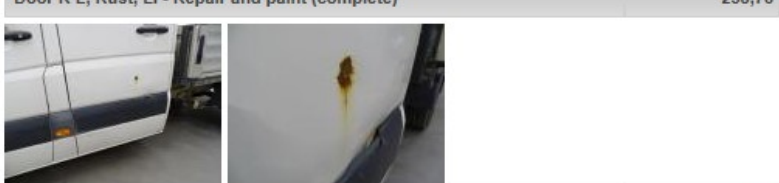

Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Front bumper, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Sill outer R, Bump(s) and scratch(es), LI - Repair and paint (complete)	232,88



Rearview mirror housing R, Stain, P - Check	0,00
---	------



Rearlight L, Crack, E - Replace	91,50
---------------------------------	-------



Door F R, Rust, Acceptable	0,00
----------------------------	------



Tailgate, Bump(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Door trim R L, Damaged, E - Replace	91,50
-------------------------------------	-------



Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	213,13
---	--------



Door F L, Rust, Acceptable	0,00
----------------------------	------



Headrest R M, Missing, E - Replace	45,00
------------------------------------	-------

