



## RENAULT Scenic: 1EAB090

Vinnumber:	<b>VF1JZT20647874847</b>	Versionname:	<b>SCENIC Expression 95PK</b>
First Registrationdate:	<b>1/10/2012</b>	Fiscalpower:	
Expertise Mileage:	<b>118983</b>	Power Kw:	<b>70</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Dark Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3308</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

## Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

## Limited Technical Inspection

Power steering	<b>Yes</b>	Battery functioning	<b>Yes</b>
Airco functioning	<b>OK</b>	Sound engine	<b>OK</b>
Tires wear profile	<b>OK</b>	Clutch test	<b>OK</b>
Idle position	<b>OK</b>	Wiper fluid level	<b>OK</b>
Engine startingtime	<b>OK</b>	Lighting	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiperblades	<b>OK</b>
Transmission	<b>OK</b>		
Handbrake	<b>OK</b>		

## Degree of wear

	<b>205/55/16/91 V Steel</b>			
Summer tyres:	Fr.L.	<b>Bridgestone: 5 mm</b>	Fr.R.	<b>Bridgestone: 5 mm</b>
	Re.L.	<b>Bridgestone: 6 mm</b>	Re.R.	<b>Bridgestone: 6 mm</b>

## Assistance equipment

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	1683,78
-------------------	---------

Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	------




Rear window, Scratch(es), E - Replace 0,00



Wheel cover F R, Scratch(es), E - Replace 30,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

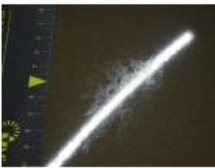

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F L, Scratch(es), E - Replace 30,00



Wing R L, Bump(s), PDR - Knock out without painting 63,00



Front bumper, Bump(s), LI - Repair and paint (complete) 211,80



Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35



Rearlight L, Crack, E - Replace 114,00

