



ROVER Evoque: 1LXL718

Vinnnumber:	SALVB2DN4GH112578	Versionname:	
First Registrationdate:		Fiscalpower:	
Expertise Mileage:	14770	Power Kw:	110
Bodytype:		Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3523
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia			
Type of headlighting:	Headlighting Xenon		
Type of Lining:	Lining fabrics		
Type of climate control:	Autom climate control		

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		


Degree of wear

225/65/17/106 V LightMetal				
Summer tyres:	Fr.L.	Dunlop: 5 mm	Fr.R.	Dunlop: 5 mm
	Re.L.	Dunlop: 7 mm	Re.R.	Dunlop: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2467,51
Ignition key, Missing, E - Replace	150,00
<i>No pictures to display</i>	
Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Chemical polution, LI - Repair and paint (complete)	382,02

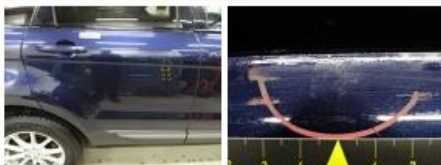

Door F R, Scratch(es), LI - Repair and paint (complete)	382,02
---	--------



Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Tailgate, Chemical polution, LI - Repair and paint (complete)	362,02
---	--------



Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Rearview mirror housing L, Chemical polution, LI - Repair and paint (complete)	115,56
--	--------



Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete)	348,09
---	--------



Interior, Dirty, Cleaning	150,00
---------------------------	--------



Roof, Chemical polution, LI - Repair and paint (complete)	577,80
---	--------

