



SKODA OCTAVIA COMBI: 1KXR880			
Vinnumber:	<b>TMBJG7NE4G0047281</b>	Versionname:	<b>1.6 CRTDI 81KW GREENTEC AMBITION</b>
First Registrationdate:	<b>27/07/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>189594</b>	Power Kw:	<b>81</b>
Bodytype:		Body color	<b>Light Grey</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type	<b>Metalic</b>
Transmission:		Rims summer	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level	<b>OK</b>
Battery functioning	<b>Yes</b>	Parking lot	<b>2825</b>
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Steel</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

Options	
Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Type of Tow bar <b>Tow bar removable</b>
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

Limited Technical Inspection			
Power steering	<b>Yes</b>	Battery functioning	<b>Yes</b>
Airco functioning	<b>OK</b>	Sound engine	<b>OK</b>
Tires wear profile	<b>OK</b>	Clutch test	<b>OK</b>
Idle position	<b>OK</b>	Wiper fluid level	<b>OK</b>
Engine startingtime	<b>OK</b>	Lighting	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiperblades	<b>OK</b>
Transmission	<b>OK</b>		
Handbrake	<b>OK</b>		

Degree of wear				
	<b>205/55/16/91 H Steel</b>			
Winter tyres:	Fr.L.	<b>Bridgestone: 7 mm</b>	Fr.R.	<b>Bridgestone: 7 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Michelin: 4 mm</b>

Assistance equipment			
Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>


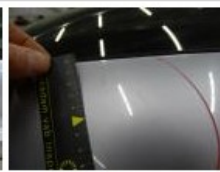

Total cost ex VAT	<b>1427,56</b>
Reflector, Damaged, E - Replace	<b>44,00</b>



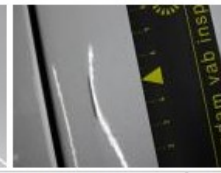


Front bumper, Scratch(es), LI - Repair and paint (complete)	<b>211,80</b>
---	---------------



Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete)	<b>301,68</b>
---	---------------

			
Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete)			290,08

			
Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)			308,20

		
Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete)		211,80

		
		
Wheel cover F L, Scratch(es), E - Replace		30,00

		
Wheel cover R L, Scratch(es), Acceptable		0,00

No pictures to display

Door R R, Bump(s), Acceptable		0,00
-------------------------------	--	------

No pictures to display

Wheel cover F R, Scratch(es), E - Replace		30,00
---	--	-------

