


BMW 3: 1GHX218

Vinnnumber:	WBA3Y11090D375806	Versionname:	3 GRAN TURISMO 318dA
First Registrationdate:	12/02/2014	Fiscalpower:	143PK Aut.
Expertise Mileage:	160721	Power Kw:	105
Bodytype:		Body color	Gold
Gearbox:	Automatic	Paint type	Metalic
Transmission:	Back	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	DANS 13.000 KM	Parking lot	1427
Maintenance	OK		
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	225/50/18/95 H LightMetal			
Winter tyres:	Fr.L.	Bridgestone: 7 mm	Fr.R.	Bridgestone: 7 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

	Runflat	Yes
Total cost ex VAT		716,98
Tailgate, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Wing R R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Boot carpet, Stain, Acceptable		0,00
<i>No pictures to display</i>		
Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)		95,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display


Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Bump(s) and scratch(es), LI - Repair and paint (complete) 220,18

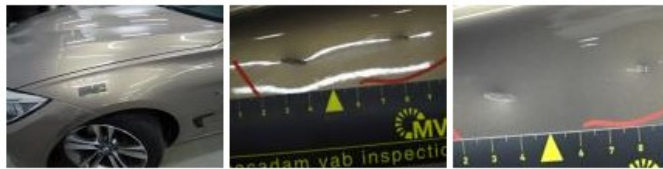

Backrest cover F L, Worn, Acceptable 0,00

No pictures to display

Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display